

Crankshaft

Inspection


- Clean the crankshaft oil passages with pipe cleaners or a suitable brush.
- Check the keyway and threads.

Alignment

- Measure runout on all main journals to make sure the crank is not bent.
- The difference between measurements on each journal must not be more than the service limit.

Crankshaft Total Indicated Runout:

Standard (New): 0.03 mm (0.001 in) max.
Service Limit: 0.04 mm (0.002 in)


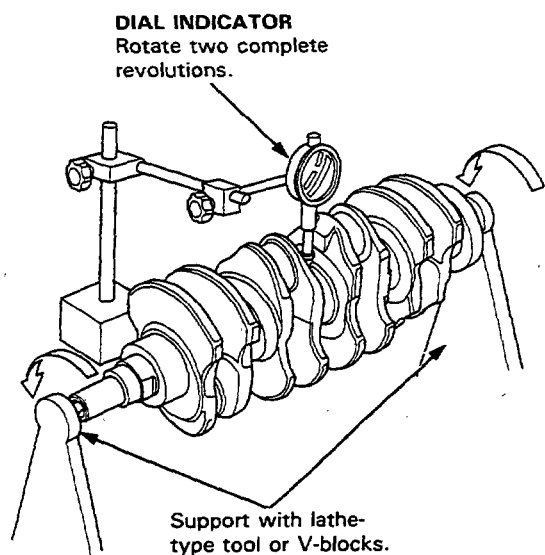


Out-of-Round and Taper

- Measure out-of-round at the middle of each rod and main journal in two places.
- The difference between measurements on each journal must not be more than the service limit.

Journal Out-of-Round:

Standard (New): 0.0025 mm (0.0001 in) max.
Service Limit: 0.005 mm (0.0002 in)

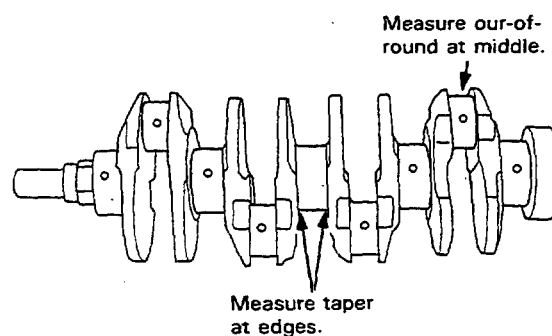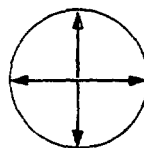

- Measure taper at edges of each rod and main journal.
- The difference between measurements on each journal must not be more than the service limit.

Journal Taper:

Standard (New): 0.0025 mm (0.0001 in) max.
Service Limit: 0.005 mm (0.0002 in)